

Illinois Commerce Commission
Pipeline Safety
Exit Meeting Documentation Form

Operator:	AMEREN ILLINOIS COMPANY
Inspection Unit(s):	Effingham
Date of Meeting:	05/27/2015
Pipeline Safety Analyst:	Aaron McElravy
Exit Meeting Contact:	Kevin Glaspy

Exit Statement

INSPECTION FINDINGS

Standard Inspection - Field Audit

Issues(s) Found:

Code Part [192.463(a)] - Staff observed a low cathodic protection reading of -.719volts obtained at 1407 S. Fourth Street in Effingham, IL.

Code Part [192.463(a)] - Staff observed a low cathodic protection reading of -.735volts obtained at 1403 S. Fourth Street in Effingham, IL.

Code Part [192.463(a)] - Staff observed a low cathodic protection reading of -.723volts obtained at 1405 S. Fourth Street in Effingham, IL.

Code Part [192.707(a)(2)] - Staff determined additional line markers were needed to adequately identify the location of the distribution main between the Take Point located at 19748 US Rt. 40 and the Montrose Town Border Station.

Notice Of Amendment(s) Found:

[NO NOAS FOUND]

Notice Of Violation(s) Found:

[NO NOPVS FOUND]

PAST INSPECTION FINDINGS

Issue(s) Corrected:

2011-S001-00102 (Code Part [192.461]) - Staff verified remedial measures were taken to correct deficiencies associated with disbonded coating identified on a previous Comprehensive Field Audit conducted on December 8, 2011. The following locations were inspected to ensure coatings were suitable to prevent atmospheric corrosion. 103, 106, 109 and 208 West Eiche Avenue, 306 and 317 West Wernsing Avenue.

2011-S001-00103 (Code Part [192.463]) - Staff verified remedial measures were taken to correct deficient cathodic protection levels identified on a previous Comprehensive Field Audit conducted on December 8, 2011. The following services were inspected to ensure adequate cathodic protection. 315 West Wernsing -1.521volts, 201 West Wernsing -1.175volts, 110 West Wernsing (Service replaced with PE), 1501 South Fourth Street -1.348volts.

2011-S001-00104 - Staff reviewed GCS records for the repair of above ground leaks identified during a previous Comprehensive Field Audit completed on December 8, 2011. The following leak case field reports were opened on December 7, 2011, repaired and closed on December 8, 2011. 311 West Wernsing #2011-0251-02, 309 West Wernsing #2011-0251-03, 108 West Eiche #2011-0251-04 and 201 West Eiche #2011-0251-05.


Notice Of Amendment(s) Corrected:

[NO NOAS CORRECTED]

Notice of Violations(s) Corrected:

[NO NOPVS CORRECTED]

Pipeline Safety Analyst Signature:

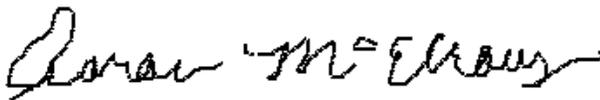

Operator Representative Signature:

Kern Alspaugh